

LAND CORNER RECORD

Index: D13	Corner: S1/16 corner between Sec. 3 and Sec. 4	<i>State of Indiana - Hoosier National Forest</i>	
Section: 4	Township: 7N	Range: 1E	P.M.: 2nd
Coordinate:	Lat./N: 1391260.03	Lon./E: 3145117.44	Datum: NAD83(sft)


CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:	Monument Photograph:
11/24/1884	M.H. Buskirk		L.S. Book 2, Page 404-407	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
	Beech	18 inch	N 50 W	20 links
	Gum	18 inch	N 67 E	19.5 links
Evidence Found:				
Monument Found:				
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:	
1984	Ken Anderson	3 inch Alum. Mon.	Provided by USFS	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
	Beech	11 inch	N 21 W	19.82 ft
	Tulip Poplar	12 inch	N 59 E	28.35 ft
Evidence Found:				
Monument Found:	3 inch Alum. Mon.			

ACCESSORIES: Describe new BTs & witness objects established to perpetuate existing evidence.

Reference Objects:	Species:	Diameter:	Bearing:	Distance:
	Beech with Mag Nail	12 inch	N 21° W	19.82 ft
	Maple with Mag Nail	21 inch	N 42° E	25.38 ft
	Poplar with Mag Nail	13 inch	N 64° E	28.35 ft
	White Oak with Mag Nail	14 inch	S 12° E	41.85 ft
Monument Found or Set:	A 3 inch aluminum monument with a cap stamped "S1/16 S.4 S.3 T7N R1E 1984"			


MONUMENT SKETCH

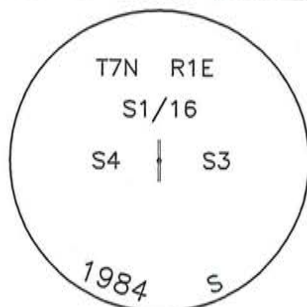

NARRATIVE REFERENCE: (Describe location relative to nearby features: roads, fences, terrain features, etc..)

The location of this monument is approximately 150 feet south of Cutright Road and approximately 40 feet south of an old East-West running Road bed. The monument also resides on a north facing slope.

SECTION DIAGRAM

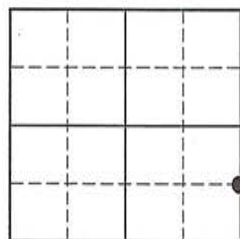

Corner Location = ●

PERPETUATION RECORD: (Describe work done to perpetuate or preserve the existing monument or position)

South 1/16 corner between Section 3 and Section 4; A stone was set and referenced at this corner in 1884 by M.H. Buskirk, but no evidence was found of the stone or the referenced trees. A 3 inch aluminum monument with cap stamped "S1/16 S.4|S.3 T7N R1E 1984" was found and accepted as the 1/16th corner. This monument was established by Ken Anderson of the U.S. Forest Service in 1984. The land corner record and reference ties for this monument are found in the office of the Hoosier National Forest - U.S. Forest Service, Mr. Anderson's notes were also provided to BRG. A Corp of Engineers 3-1/4" brass disc set in the top of a 0.5 feet diameter concrete cylinder was found North 32 degrees 39' 16" East, 17.21 feet. A 5/8" rebar with plastic cap stamped "Graham PC 9800014" was found North 00 degrees 39' 48" West, 13.96 feet. Both monuments are located on the East-West Monroe Lake Fee line. The Graham rebar is located at the intersection of the Fee Line and the Section Line. Graham's 2000 survey accepted the U.S. Forest Service monument set by Ken Anderson in 1984 as the South 1/16th corner, while Doug Curry's 2008 survey accepted the Corp of Engineers Fee Line monument as the South 1/16th corner.

Section: 4

Prepared By: BRG

Date: 12/2011

Referenced on BRG survey recorded as InstNo.2012002880

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.